

SPOT LINE

MOVE IT 25
050-0222438M



Project / Type

Notes

Count / Date



General

Ceiling / Wall , Track

black , RAL9005 ¹

IP20

1350 lm

LED

2700 K

CRI ≥ 97

L95 / 50000 h

initial MacAdam ≤ 3 SDCM

R_g: 101 , R_f: 96 , R_{f(1-5)}: 96

MR 0.59

MDER 0.53

Optical

medium

UGR < 16

PstLM ≤ 1.0 ²

SVM ≤ 0.4 ²

Electrical

DALI-2 single control

system 17.9 W

PC3 48V

system 75 lm/W³

1 DALI Addr.

Physical

length 605 mm


width 25 mm

height 45 mm

0.4 kg

Linear light inset made of aluminium; surface anodised black; light inset can be installed and moved without tools by means of magnetic holders+locking; flush with profile system; power supplied via MOVE IT system track profile; hot plug protection; fitted with single LED light points; passive cooling of the LEDs through improved heat sink geometry; with CSP (Chip-Scale-Packaging) technology for maximum efficiency; light colour 2700 K; binning initial MacAdam ≤ 3 SDCM; CRI ≥ 97; min. 95% of luminous flux after 50000 operating hours; energy efficient LEDs with high CRI; good glare control through recessed light point level; inserted lenses with medium radiation characteristic 31°; UGR ≤ 16; degree of protection IP20; PC3 48V; DALI single control; flicker-free visual comfort through analogue current control (minimum value 1%); light source not replaceable;

Light distribution

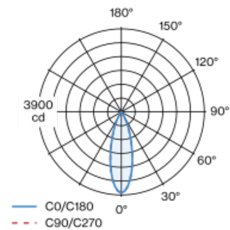

Product drawing



¹ RAL code ² Value of containing product at full load (undimmed)
³ incl. optical losses and the efficiency of the operating device (converter)

Installation instructions



SPOT LINE

MOVE IT 25
050-0222438M



Project / Type

Notes

Count / Date

Maintenance Factors

Operating Time [h]	10 000	20 000	30 000	40 000	50 000
LLMF	0.98	0.98	0.97	0.96	0.95
LSF	1	1	1	1	1

MF

MF

LMF^a

LMF × RSMF × LLMF × LSF

Maintenance Factor

Luminaire Maintenance Factor

RSMF^a

LLMF

LSF

Room Surface Maintenance Factor

Lamp Lumens Maintenance Factor

Lamp Survival Faktor

^a According to "CIE 97, Maintenance of indoor electric lighting systems", 2005, ISBN 3-900-734-34-8. The values must be determined by the planner.

