

NOBA 40 adjustable

MOVE IT 10

030-6800438



Project / Type

Notes

Count / Date



General

Ceiling / Wall , Track

tilt max 90°

rotation 365°

jet black , RAL9005 ¹

IP20

382 lm

LED

2700 K

CRI ≥ 90

L80 / 50000 h

initial MacAdam ≤ 2 SDCM

R_g: 99 , R_f: 91 , R₍₁₋₁₅₎: 89

MR 0.53

MDER 0.48

Optical

wide flood


beam angle 69°

PstLM ≤ 1.0 ²

SVM ≤ 0.4 ²

Decorative spotlight inset made of aluminium; surface jet black powder coated; 365° rotatable and 90° tiltable; light inset can be installed and moved without tools by means of clip mount; power supplied via MOVE IT system track profile; hot plug protection; passive cooling of the LEDs through improved heat sink geometry; light colour 2700 K; binning initial MacAdam ≤ 2 SDCM; CRI ≥ 90; min. 80% of luminous flux after 50000 operating hours; energy efficient LEDs with high CRI; high quality plano-convex glass lens; beam angle 69°; no multiple shadows; degree of protection IP20; PC3; DALI-2 control; flicker-free visual comfort through analogue current control (minimum value 1%); light source replaceable by an authorized professional;


Light distribution

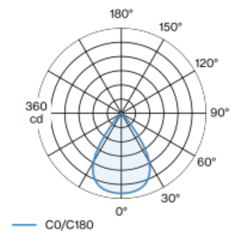

wide flood 69°

h (m)	EO° (lx)	ø (m)
1	338	1.37
2	84	2.74
3	38	4.12
4	21	5.49
5	14	6.86

Product drawing

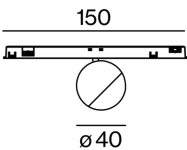

Electrical

DALI-2

48 V

inset 3.5 W

PC3

inset 109 lm/W³

1 DALI Addr.

Physical

diameter 40 mm

height 40 mm

¹ RAL code ² Value of containing product at full load (undimmed)
³ incl. optical losses and the efficiency of the operating device (converter)

Installation instructions



NOBA 40 adjustable

MOVE IT 10

030-6800438



Project / Type

Notes

Count / Date

Maintenance Factors

Operating Time [h]	10 000	20 000	30 000	40 000	50 000
LLMF	0.96	0.92	0.88	0.85	0.81
LSF	1	1	1	1	1

MF	LMF × RSMF × LLMF × LSF	RSMF ^a	Room Surface Maintenance Factor
MF	Maintenance Factor	LLMF	Lamp Lumens Maintenance Factor
LMF ^a	Luminaire Maintenance Factor	LSF	Lamp Survival Faktor

^a According to "CIE 97, Maintenance of indoor electric lighting systems", 2005, ISBN 3-900-734-34-8. The values must be determined by the planner.

